



Assembly Instructions

1) Slide the ferrule onto the cable. Strip the cable to the dimensions shown. Take care not to nick the centre conductor or braid.


A = 5.2mm
B = 2.7mm
C = 2mm

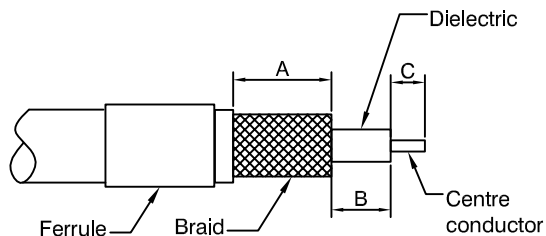

2) Crimp the contact onto the centre conductor.

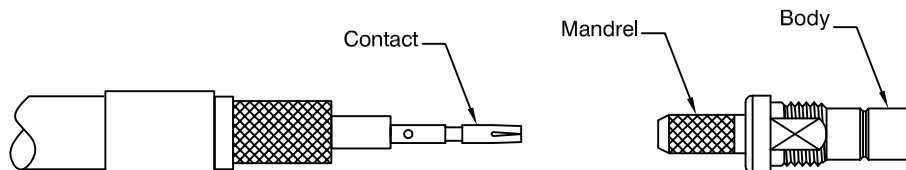

 3) Insert the contact into the body and ensure that it captivates. Make sure that the braid is on the outside of the mandrel. Slide the ferrule over the braid until the ferrule butts up against the body. Crimp the ferrule using the correct tool for the connector.



Connector Part Number	Stripping Tool Part Number	Crimp Tool Part Number	Hex Size	
			Pin	Ferrule
VMB40-2061	N/A	PCC0308	0.72	3.25
VMB40-2071	N/A	PCC0308	0.72	3.25
VMB40-2081	N/A	PCC0308	0.72	2.67

CAD Issue	SN	2	01 Nov 01
First Issue	AT	1	27 May 98
DESCRIPTION OF REVISION	APPVD	ISS	DATE



Cinch Connectivity Solutions, Ltd
11 Bilton Road
Chelmsford
Essex CM1 2UP, England
T: +44 (0) 1245 342060
F: +44 124 535 8938

SCALE: Not To Scale

DIMENSIONS: mm

TOLERANCES:

DRAWN BY:

S Nash

CHECKED BY:

P Couzens

APPROVED BY:

M Nielsen

DATE:

01 Nov 01

DESCRIPTION:

Stripping and Assembly
Instructions for SMB Crimp
Bulkhead Jack.

DRAWING NUMBER:

VAIM4101

PAGE: 1 OF 1