

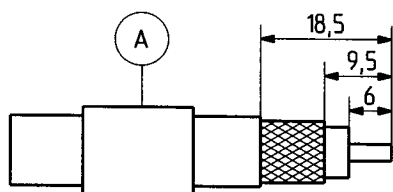


Assembly instruction Series N B No. 27064


Tools and materials required: Small saw : SUHNER 74 Z - 0 - 0 - 12 Knife or razor blade Scissors, file Crimp tool (see table)	Straight connector for flexible cables	
	Cable entry: SUHNER Full Crimp	
	Connector types: (e.g.) 11 N 50-7-37/16 N 50-7-28/24 N 50-7-24/25 N 50-7-24	
This connector is supplied in 3 parts.	Suitable cable:	RG 393/U
	Centre contact:	cavity 4
	Braid:	cavity D
	Crimp tool:	4 D

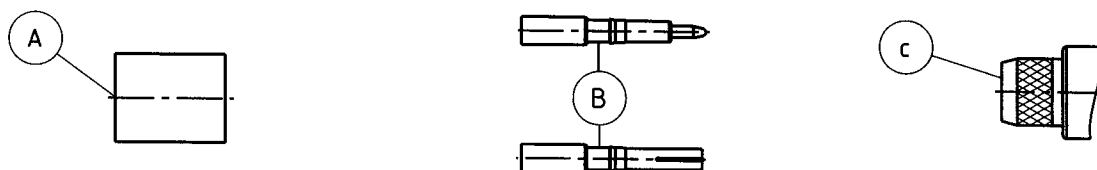


Slide ferrule A onto cable.
Prepare cable according to diagram.
CAUTION: Do not damage braid and inner conductor of cable!

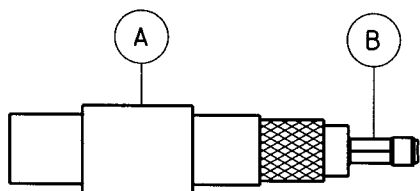

Push contact B over inner conductor of cable to abut cable dielectric and crimp.

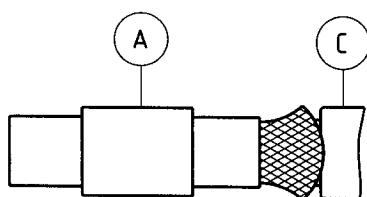

Splay out braid.
Insert centre contact B into connector body C as far as stop.
Ensure that braid lies above the crimp neck.

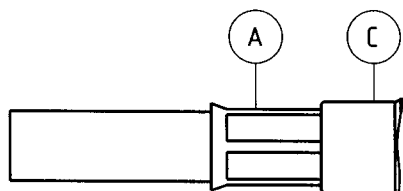

Slide ferrule A over braid and crimp as close to connector body C as possible.

SUHNER's skilled staff and specialised equipment are available to carry out complete R.F. lead-assembly on your behalf. We mount your connectors on cables at economic prices! Please contact our representative for further details of this service.



HUBER + SUHNER AG CH-9100 HERISAU

Deutscher Text: siehe Rückseite

Montageanleitung

Serie N B Nr. 27064

Benötigte Hilfsmittel:

Kleine Metallsäge : SUHNER 74 Z - 0 - 0 - 12
 Messer oder Rasierklinge
 Schere, kleine Feile
 Klemmwerkzeug (siehe Tabelle)

Gerader Verbinder für flexible Kabel

Kabeleinführung: SUHNER Voll-Klemmung

Verbinder Typen: (z.B)

11 N 50-7-37/16 N 50-7-28/24 N 50-7-24/25 N 50-7-24

Dieser Verbinder
 wird in 3 losen
 Teilen geliefert.

Geeignete Kabel:

RG 393/U

Innenleiter:





Aussparung 4

Aussenleiter:


Aussparung D

Klemmwerkzeug:


4 D

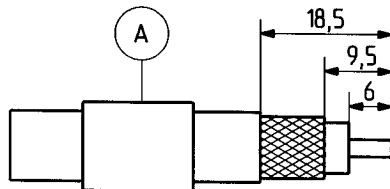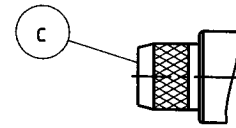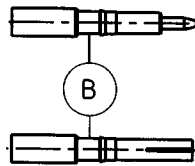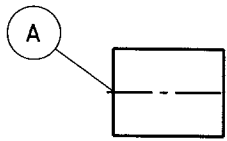


Hülse A auf das Kabel schieben.
 Kabel gemäss Figur abisolieren.
ACHTUNG: Innenleiter, Abschirmung und
 Dielektrikum nicht beschädigen.

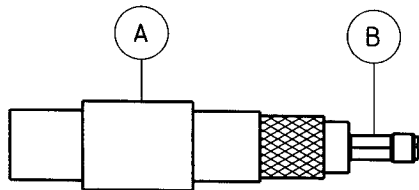

Innenleiter B über Kabelinnenleiter schieben
 und mit entsprechendem Werkzeug klemmen.

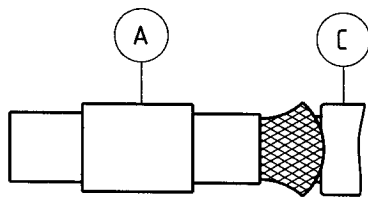

Abschirmung leicht aufspreizen.
 Vorbereitetes Kabel in Gehäuse C bis zum Anschlag
 einführen.
 Abschirmung muss über Klemmhals liegen.

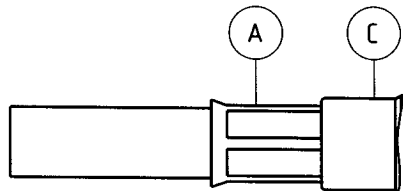

Hülse A über Abschirmung schieben und möglichst nahe
 am Gehäuse C klemmen.

SUHNER verfügt über gut ausgebildete Fachkräfte und rationelle Einrichtungen zur Herstellung kompletter HF-Verbindungsleitungen. Wir montieren Ihre Verbinder zu wirtschaftlichen Preisen! Wenden Sie sich an unsere Vertreter.



HUBER + SUHNER AG CH-9100 HERISAU

for English text see overleaf