

1 Products affected

Product hierarchy no. *			Part no.	SBU	Type / Description	Customer part no.
SBU PG	PGU	Type				
02	007	038	0000002296	4796.0000	Connector	4796 Appliance Inlet
02	007	038	0000002365	4310.0008	Connector	0106 Appliance Inlet
02	007	038	0000002365	4310.0009	Connector	0106 Appliance Inlet

*SBU (2-digit) / PG (3-digit) / PGU (3-digit) / Type (10-digit)

2 Type of change


A new tool has been made.
Modification of the Approval marks.
With the production of the new tool the Tension relief has changed too.

3 Detailed description of change

Old Version (Approval marks)




The flange of the Tension relief was round, what caused an insufficient hold of the Tension relief.

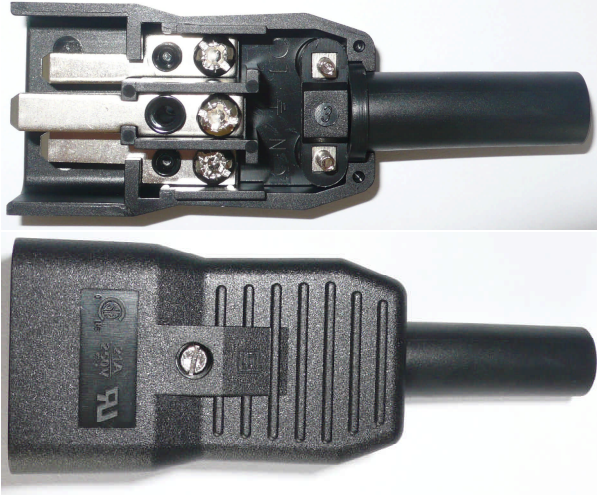

New Version (Approval marks)



NEW the flange of the Tension relief is square, what improves the holding of the Tension relief.

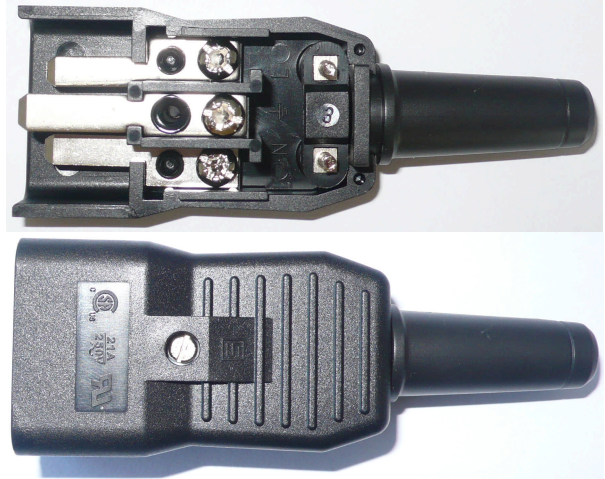

4 Reason of change

With the production of the new tool the Approval marks got updated according to UL/ CSA/ IEC/ CCC.

According to 60320-1 sect. 22 (Cords and their connection) the Tension relief with the round flange could fall out at the test. As there have been made new tools for the moulding parts the holding of the Tension relief got improved with a square nut. The Tension relief has new a square flange.

4796`#\$\$`*					0118.2127	
creation date	created by	release date	released by	notification no.	revision	page
2012-09-13	sha	2012-09-14	sha	23911		1 of 2

5 Released date

Release of production

Ww 38

6 Impact of change and recommended action

Form: Square flange on the Tension relief / New Approvalmarks
 Fit: n/a
 Function: Better holding of the Tension relief
 Production Site: New tool
 Product Label: n/a

7 Reference Documents / Attachments

Kind of document	Document number	Remarks
PCN	0118.2109	Tension relief new with square flange

4796					0118.2127	
creation date	created by	release date	released by	notification no.	revision	page
2012-09-13	sha	2012-09-14	sha	23911		2 of 2